#### 5494LP LOW PRESSURE FEED THROUGH

Datasheet

#### **OVERVIEW**

Metrix Low Pressure cable seals prevent oil wicking with proximity probe sensors in rotating equipment. The seals include a grommet that provides a tight seal and also allows adjustment of the cable position.

The split grommet on the Metrix Low Pressure Feed Through fits over the cable where access to the cable ends isn't practical. Tightening the fitting compresses the grommet, forming the seal. To adjust the position of the cables in the seal, simply loosen the fitting to decompress the grommet and pull the cable through the grommet to the desired position and retighten the fitting.

Note:

- Plugs are provided to fill unused holes in split grommets (4)
- Insulated leadwires must be used; do not use bare stranded wires
- Wires must be oil sealed on sensor end

## **SPECIFICATIONS**

Fitting Material: 316 Stainless steel Grommet Material: Fluoroelastomer Temperature Range (Grommet): Fluoroelastomer: -40° to 90°C (-40° to 194°F) Pressure: 50 psi (3.4 bar) at 20°C Ingress Protection Rating: IP66 Connection Thread: 3/4″ NPT Process Thread: 3/4″ NPT Overall Length: 3.25″ (82mm)

# HAZARDOUS AREA RATINGS


Class I Div I or Class I Div II  $\mathfrak{G}_{\mathbb{R}}^{*}$ ( $\mathfrak{E}_{\mathbf{X}}$ ) II 1G Ex ia IIC T4 Ga or ( $\mathfrak{E}_{\mathbf{X}}$ ) II 3G Ex nA IIC T4 Gc When Used With MX8030/MX2030, MX8031/MX2031 Per Drawing #1086567 or other appropriately approved product.

"Warning" keep cover tight to prevent ignition of hazardous atmosphere, disconnect circuits before removing cover, seals are required within 6" (152mm) of enclosure on all conduits if used in a hazardous area.

## **HOW TO ORDER**

5494LP - AAA	
AAA	DESCRIPTION
001	Feed Through, Strain Relief, Low Pressure Cable Seal, 2X 3/4 NPT, 316 SST, Hazardous Areas
003	Feed Through, Strain Relief, Low Pressure Cable Seal, 2X 1/2 NPT, 316 SST, Hazardous Areas
004	Feed Through, Strain Relief, Low Pressure Cable Seal, 3/4 NPT CONNECTION & 1/2 NPT PROCESS, 316 SST, Hazardous Areas
005	Feed Through, Strain Relief, Low Pressure Cable Seal, 1/2 NPT CONNECTION & 3/4 NPT PROCESS, 316 SST, Hazardous Areas



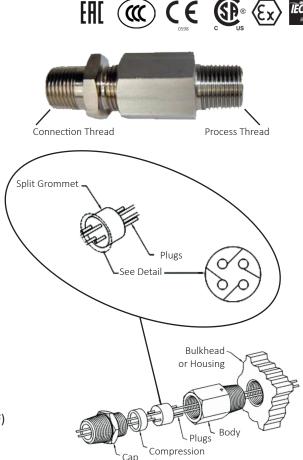

Plug